



# **febie**XAKT



### **Multi-V Belts**

## febi no. 28885

repl. No. 77 00 111 671

fits

Renault 1.4 16V (K4J) and 1.6 16V (K4M) Engines with air conditioning systems



#### >> PROBLEM:

The v-ribbed belt is noisy, wears quickly and may tear.

#### >> CAUSE:

The original version of the v-ribbed belt has 6 ribs. Using the 6-ribbed belt may lead to the belt flank wearing faster and ribs being ripped out (see Fig. 1). The result may be major engine damage.

#### >> SOLUTION:

Renault has adjusted the belt. febi recommends using febi belt 28885 (repl. no. 77 00 111 671). The new version has 5 ribs while all belt pulleys have 6 grooves. This prevents faster wear and premature tearing. The new version also reduces noise and achieves a longer belt life.

#### >> NOTE ON FITTING:

Please note that the belt must be placed onto the grooves such that the inner groove remains free on all belt pulleys (see Fig. 2).

#### >> PLEASE NOTE:

Please also make sure to check that the freewheeling alternator pulley is working perfectly before replacing the belt.





Tel. +49 2333 911-0 Fax +49 2333 911-444 E-Mail info@febi.com

