



professional

Timing chain kit

fits

Seat Altea, Altea XL, Škoda Octavia
VW Golf PLUS, Golf V, Passat Variant and more

PROBLEM

Problems with the timing chain in vehicles with 1.4 TSI engines.

CAUSE

The series manufacturer has reported quality problems with the individual components. Worn tools used during production have left behind metal burrs on the chain links. This leads to premature wear on the chain.

SOLUTION

Make sure that you have installed the latest version of the camshaft adjusters. The manufacturer has replaced the camshaft adjusters which have the OE number 03C 109 088 E. The manufacturer explicitly states that the new version must be installed.


ATTENTION!

Afterwards, carry out a system update of the engine control unit to ensure that the engine runs properly!



SWAG No. 30 94 0672

Repl. No. 03C 109 158 A S1

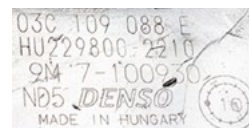

New Version
Repl. No. 03C 109 088 E



Chain tensioner
SWAG No. 30 93 6484



Timing chain SWAG No. 30 94 0390

Register now for the official SWAG newsletter and receive the latest technical information automatically by email!

Further information may be obtained at:
www.swag-parts.de