



## Service Info



# Replacement of tensioner and vibration damper

Manufacturers: Audi, Seat, Škoda, VW

**Models:**

Audi: A4, A6  
 Seat: Exeo  
 Škoda: Superb  
 VW: Passat

Engine codes: AWT, AWM, ALT, AVJ, AMB, BFB, BEX, BKB, CFMA

Part nos: 531 0531 20 (replaced)  
 533 0028 20 (replaced)  
 530 0546 09 (new/Set)  
 530 0546 10 (new/KIT)

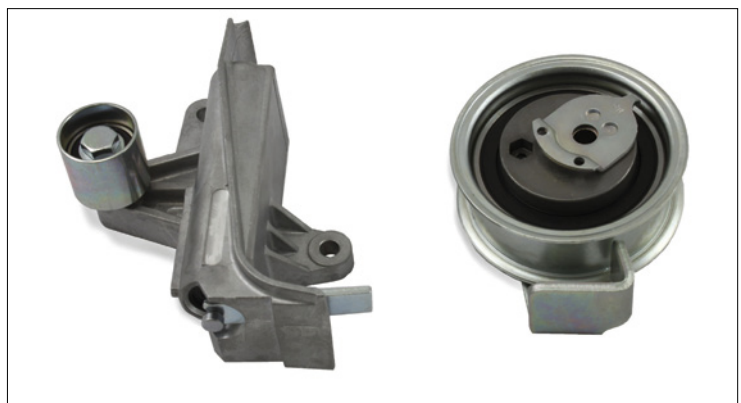


Image 1: Vibration damper 533 0028 20 (left), tensioner 531 0531 20 (right)

In the vehicles listed above, vibration damper 533 0028 20 (Image 1, left) and tensioner 531 0531 20 (Image 1, right) have been replaced with KIT 530 0546 10 (Image 2, left) and Set 530 0546 09 (Image 2, right).

The new components differ not only in terms of their appearance but also in terms of their functionality. With the old design, the vibration damper, in addition to the tensioner, took on part of the belt tensioning function.

The new deflecting pulley with holder 532 0601 10 only has a deflecting function. The belt tension and damping is carried out by tensioner 531 0840 10 only.

The use of mixed components is not permitted, as the components are adapted to one another and only ensure the correct belt tension when used together.



Image 2: KIT 530 0546 10 (left), Set 530 0546 09 (right)

Observe the specifications of the vehicle manufacturer!

Spare parts and technical information can be found under [www.schaeffler-aftermarket.com](http://www.schaeffler-aftermarket.com) or [www.RepXpert.com](http://www.RepXpert.com).

Phone: +44 (0) 14 32 264 264\*  
 Fax: +44 (0) 14 32 375 760  
 info@luk-as.co.uk  
 www.schaeffler-aftermarket.com

\* Calls from within the UK 08457 001100

**SCHAEFFLER**  
 AUTOMOTIVE AFTERMARKET

