



Service Info



Tensioner pulley 531 0809 10

Specific points to note during installation

Manufacturers: Audi, Seat, Škoda, VW

Models:

Audi: A1, A3, A4, A5, A6, Q3, Q5, TT

Seat: Altea, Exeo, Ibiza, Leon, Toledo

Škoda: Fabia, Octavia, Rapid, Roomster, Superb, Yeti

VW: Amarok, Beetle, Caddy CC, Crafter, EOS, Golf, Jetta, Passat, Scirocco, Tiguan

Engine: 2.0 TDI

Part no.: 531 0809 10

OE numbers: 03L 109 243 A
03L 109 243 E

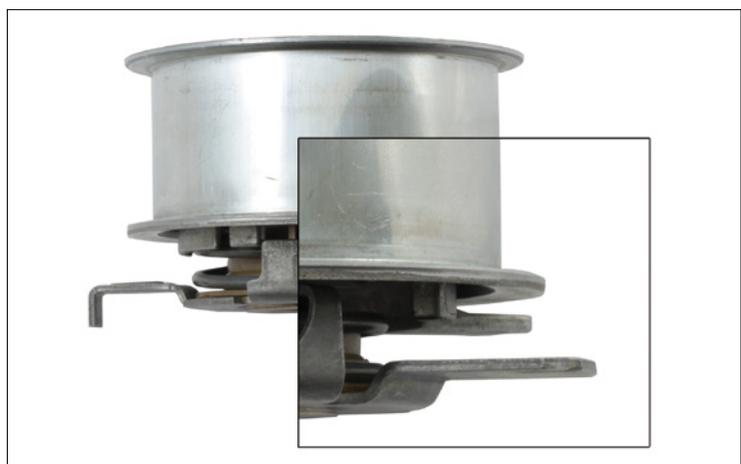


Image 1: Tensioner pulley as it is when delivered

In the condition in which it is delivered (image 1), tensioner pulley 531 0809 10 is not yet in the correct position for installation. Before installing the component, the pulley must be brought into the correct position (image 2) by pushing the elements together in the axial direction.

Details of how to install the component can be found in the non-verbal fitting instructions enclosed in the package.

Only if the tensioner pulley has been installed in the proper manner is it possible to correctly pre-tension the toothed belt, and thus ensure the timing is also correct.

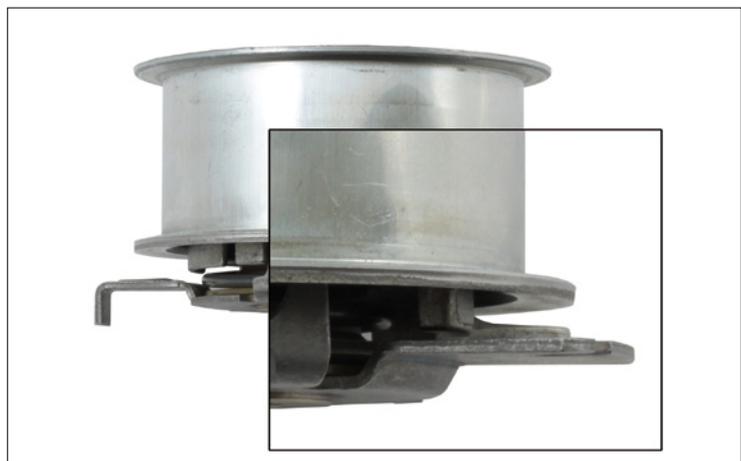


Image 2: Tensioner pulley in the installation position

Observe the specifications of the vehicle manufacturer!

Spare parts and technical information can be found under www.schaeffler-aftermarket.com or www.RepXpert.com.

Phone: +44 (0) 14 32 264 264*
Fax: +44 (0) 14 32 375 760
hfd-info@schaeffler.com
www.schaeffler-aftermarket.com

* Calls from within the UK 08457 001100

SCHAEFFLER
AUTOMOTIVE AFTERMARKET

