

Product info sheet


Robert Bosch

0445020002

Special tools needed?

Yes

Fix crankshaft with locking pin

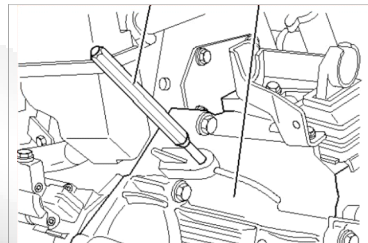

Product specific information

Programming

No

Unlocking

No

Adaption values reset

No

Bleed

Yes

ignition on for 30 seconds

adjustment at mounting_1

No

adjustment at mounting_2

--

Tightening torques

Mounting fuelpump flange

25 Nm

Fuel connection

20 Nm

High Pressure pipe nuts

20 Nm on pump, 27 Nm on rail

Pump pulley/sprocket

30 Nm

Tensioner timingbelt, -chain

40 Nm

Bolt crankshaft

200 Nm

Assembly instructions

Recommendation: replace fuel filter

Core charge terms:

- externally intact,
- no mechanical damage,
- not dismantled,
- no heavy corrosion.