

Product info sheet


Robert Bosch

0470506016

Special tools needed?

Yes

- 1: Place timingpin in crank to fix
- 2: Timingpin to fix injectionpump

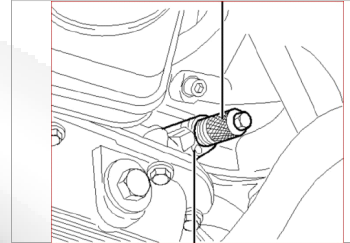

Product specific information

Programming

No

Unlocking

No

Adaption values reset

No

Bleed


Yes

Help with manual pump before fuel filter

adjustment at mounting_1

Yes


Camshaft with mark (fixed crankshaft)

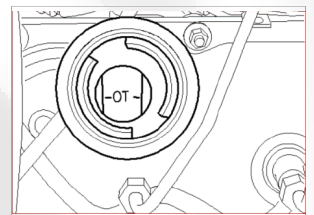

adjustment at mounting_2

Yes

Injection point set by timing pin

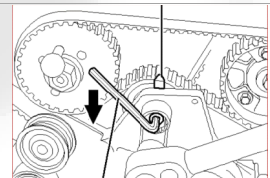

Tightening torques

Mounting fuelpump flange

10 Nm

Mounting fuel pump bracket

20 Nm

High Pressure pipe nuts

30 Nm

Tensioner timingbelt, -chain

36 Nm

Pump pulley/sprocket

22 Nm (shock absorber fuel pump: 20 Nm)

Assembly instructions

Recommendation: replace fuel filter

Core charge terms:

- externally intact,
- no mechanical damage,
- not dismantled,
- no heavy corrosion.